View NSN Online: https://aerobasegroup.co.il/nsn/8010-00-297-0560

## PRATT AND LAMBERT INC -- ENAM ALKYD LSTRLESS LO VO CT OL DR 34088 -- 8010-00-297-0560

Product ID:ENAM ALKYD LSTRLESS LO VO CT OL DR 34088

MSDS Date:06/29/1990

FSC:8010

NIIN:00-297-0560

MSDS Number: BJLFM === Responsible Party ===

Company Name: PRATT AND LAMBERT INC

Address:16116 E 13TH ST

Box:2153 City:WICHITA

State:KS ZIP:67201 Country:US

Info Phone Num:316-73

3-1361

Emergency Phone Num:716-873-6000 DOT EMER 8002553924

Preparer's Name: W. A. ELLISON

CAGE:61196

=== Contractor Identification ===

Company Name: PRATT AND LAMBERT INC

Box:6027

City:CLEVELAND

State:OH

ZIP:44101-1027 Country:US

Phone:216-566-2902

CAGE:61196

======= Composition/Information on Ingredients ========

Ingred Name: METHYL ISOAMYL KETONE

CAS:110-12-3

RTECS #:MP3850000 Fraction by Wt: 5%

Other REC Limits: NONE SPECIFIED

OSHA PEL:100 PPM ACGIH TLV:50 PPM; 9293

Ingred Name:X

YLENES (O-,M-,P- ISOMERS) (SARA III)

CAS:1330-20-7

RTECS #:ZE2100000 Fraction by Wt: 10%

Other REC Limits:LFL 1.0/UFL 7.0 OSHA PEL:100 PPM/150 STEL ACGIH TLV:100 PPM/150STEL;9192

EPA Rpt Qty:1000 LBS DOT Rpt Qty:1000 LBS

Ingred Name: ETHYL BENZENE (SARA III)

CAS:100-41-4

RTECS #:DA0700000 Fraction by Wt: < 5%

Other REC Limits:LFL 1.0/UFL 6.7 OSHA PEL:100 PPM/125 STEL ACGIH TLV:100 PPM/125STEL 9192

EPA Rpt Qty:1000 LBS DOT Rpt Qty:1000 LBS

Ingred Name: NAPHTHA, LIGHT AROMATIC

CAS:64742-95-6

Frac

tion by Wt: 5%

Other REC Limits: NONE SPECIFIED

Ingred Name: N-BUTYL ACETATE (SARA III)

CAS:123-86-4

RTECS #:AF7350000 Fraction by Wt: 5%

Other REC Limits:LFL 1M7/UFL 7.6 OSHA PEL:150 PPM/200 STEL ACGIH TLV:150 PPM/200STEL;9192

EPA Rpt Qty:5000 LBS DOT Rpt Qty:5000 LBS

Ingred Name: TALC (CONTAINING NO ASBESTOS)

CAS:14807-96-6

RTECS #:WW2710000 Fraction by Wt: 40%

Other REC Limits: NONE SPECIFIED

OSHA PEL:2 MG/M3 RDUST

ACGIH TLV:2 MG/M3 RDUST; 9192

Ingred Name: SILICA, CRYSTALLINE - QUARTZ

CAS:148

08-60-7

RTECS #:VV7330000 Fraction by Wt: < 1%

Other REC Limits: NONE SPECIFIED

**OSHA PEL:SEE TABLE Z3** 

ACGIH TLV:0.1 MG/M3 RDUST;9293

Ingred Name: METHYL ETHYL KETONE (2-BUTANONE) (MEK) (SARA III)

CAS:78-93-3

RTECS #:EL6475000 Fraction by Wt: 5%

Other REC Limits:LFL 2.0/UFL 10.0 OSHA PEL:200 PPM/300 STEL ACGIH TLV:200 PPM/300STEL 9192

EPA Rpt Qty:5000 LBS DOT Rpt Qty:5000 LBS

Ingred Name: VOC 3.07 LB/GAL LESS WATER & NEGLIGIBLY PHOTOCHEMICALLY REACTIVE MATERIALS 368 G/L LESS WATER.

RTECS #:99 99999VO

Other REC Limits: NONE SPECIFIED

Ingred Name: VOC 5.39 LB/GAL SOLIDS 647 G/L SOLIDS.

RTECS #:9999999VO

Other REC Limits: NONE SPECIFIED

=========== Hazards Identification ==========================

Routes of Entry: Inhalation:YES Skin:YES Ingestion:YES Reports of Carcinogenicity:NTP:NO IARC:YES OSHA:NO

Health Hazards Acute and Chronic:SWALLOWING MAY CAUSE GASTROINTESTINAL IRRITATION & CHEMICAL PNEUMONITIS. INHALATION MAY CAUSE NOSE OR THROAT IRRIT & ACUTE CENTRAL NER

**VOUS SYSTEM DEPRESSION. MAY ALSO** 

IRRITATE EYES, SKIN & IF ABSORBED IN HARMFUL AMTS MAY CAUSE DEFATTING OFSKIN. OTHER EFFECTS: LIVER DAMAGE, PERMANENT BRAIN & NERVOUS SYS DAMAGE & DEATH.


Explanation of Carcinogenicity: CRYSTALLINE MAY CAUSE LUNG DISEASE & HAS BEEN LISTED AS A CARCINOGEN BY THE IARC.

Effects of Overexposure:GASTROINTESTINAL IRRITATION, CHEMICAL PNEUMONITIS, HEADACHES, DIZZINESS, NAUSEA, CONFUSION & SEVERE IRRITATION REACTION IF PRODUCT IS SWALLOWED, INHALED

THROUGH SKIN, OR GETS INTO EYES.  Medical Cond Aggravated by Exposure: CHEMICAL PNEUMONITIS, ACUTE CENTRAL NERVOUS SYSTEM DEPRESSION, DAMAGE TO LIVER, KIDNEYS & BLOOD, RESPIRATORY CONDITIONS, PERMANENT BRAIN & NERVOUS SYSTEM DAMAGE & DEATH.
======================================
First Aid:SWALLOWING: DO NOT INDUCE VOMITING. CALL POISON CONTROL CENTER IMMEDIATELY. INHALATION: REMOVE TO FRESH AIR IMMEDIATELY. IF BREATHING STOPPED, GIVE CPR & KEEP WARM & QUIET. EYE: FLUSH WITH LARGE AMT S OF WATER FOR 15 MIN LIFTING UPPER/LOWER LIDS CONTINUOUSLY. SKIN: REMOVE CONTAMINATED CLOTHING & WASH AFFECTED AREA WITH SOAP & WATER. GET MEDICAL ATTENTION IMMEDIATELY FOR ANY OF THESE PROBLEMS.
============ Fire Fighting Measures ============
Flash Point:24F/-4C Lower Limits:SEE INGRED. Upper Limits:SEE INGRED. Extinguishing Media:USE CARBON DIOXIDE, ALCOHOL FOAM, OR DRY CHEMICAL TO EXTINGUISH FLAMMABLE LIQ FIRES. USE POLYMER FOAM FOR LARGE FIRES. Fire Fighting Procedures:WATER MAY BE INEFFEC BUT USED TO COOL EXPOSED CONTAINERS TO PREVENT PRESSURE BUILDUP & POSSIBLE AUTO-IGNITE/EXPLOS. IF WATER IS USED, FOG NOZZLES ARE PREFERRED. Unusual Fire/Explosion Hazard:OVEREXPOSURE TO DECOMPOSITION PRODUCTS MAY CAUSE HEALTH HAZARD. SYMPTOMS MAY NOT BE IMMEDIATELY APPARENT OBTAIN MEDICAL ATTENTION.
======== Accidental Release Measures ==========
Spill R elease Procedures:WEAR RESPIRATORS, APPROPRIATE BODY PROTECTION. KEEP SPECTATORS AWAY. ELIMINATE ALL IGNITE SOURCES, CONTAIN SPILL W/INERT MATERIAL, TRANS LIQ TO COV METAL CONTAINERS FOR DISPOSAL. USE ONLY NON-SPARK TO OLS. PREVENT CONTAMINATION OF SEWERS & GROUNDWATER  ===================================

, ABSORBED

Handling and Storage Precautions:DO NOT STORE ABOVE 95 DEGREES F. STORE LARGE QUANTITIES IN COMPLIANCE WITH OSHA 29CFR1910.106. Other Preca

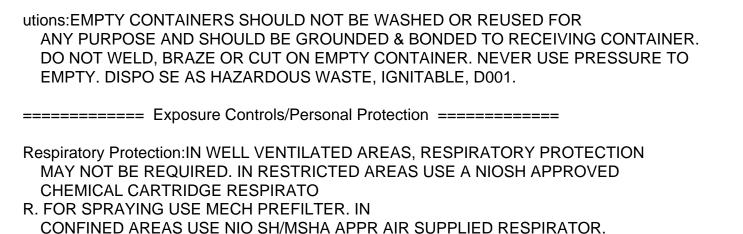

OF HAZARDOUS INGREDIENTS.
Protective Gloves:WEAR SOLVENT IMPERMEABLE GLOVES.

Eye Protection: WEAR SAFETY SPECTACLES.

Work Hygienic Practices: EYEWASH FACILITY, SAFETY SHOWER. DO NOT TAKE INTERNALLY. CLOSE CONTAINER AFTER EACH USE & DO NOT BREATHE SANDING DUST.

Ventilation: DILUTE & LOCAL EXHAUST RECOMMENDED TO CONTROL CONCENTRATE

Supplemental Safety and Health

=======================================	Phy
sical/Chemical Properties	============

HCC:F2

Boiling Pt:B.P. Text:139 TO 348F

Vapor Density:> THAN AIR

Spec Gravity:1.4

Evaporation Rate & Evaporation R

Percent Volatiles by Volume:43%

======== Stability and Reactivity Data ===========

Stability Indicator/Materials to Avoid:YES

STRONG ACIDS, ALKALINE OR OXIDIZING MATERIALS.

Stability Condition to Avoid:AVOID EXCESSIVE HEAT AND SOURCES OF IGNITION.

Hazardous Decomposition Products:BURNING, HEAT B

Y WELDING OR CUTTING,

WILL PRODUCE SMOKE, CARBON MONOXIDE AND CARBON DIOXIDE.

Conditions to Avoid Polymerization: KEEP AWAY FROM HEAT SPARKS AND FLAME.

	Disposal (	Considerations	
--	------------	----------------	--

Waste Disposal Methods:DISPOSE OF IN I/A/W FEDERAL, STATE & LOCAL LAWS. INCINERATE ONLY IN EPA PERMITTED FACILITY. DO NOT INCINERATE CLOSED CONTAINERS. OBSERVE PRECAUTIONS FOR DISP OF FLAMMABLE MATERIALS. CONTAMINATED ABSOR BENT MAY BE DISPOSED IN A HAZARD WA

## STE LANDFILL.

Disclaimer (provided with this information by the compiling agencies): This information is formulated for use by elements of the Department of Defense. The United States of America in no manner whatsoever, expressly or implied, warrants this information to be accurate and disclaims all liability for its use. Any person utilizing this document should seek competent professional advice to verify and assume responsibility for the suitability of this information to their par ticular situation.