View NSN Online: https://aerobasegroup.co.il/nsn/6140-01-299-8849

N/P -- LEAD-ACID BATTERY -- 6140-01-299-8849

Product ID:LEAD-ACID BATTERY

MSDS Date:01/01/1987

FSC:6140

NIIN:01-299-8849

MSDS Number: CHHTJ === Responsible Party ===

CAGE:20038

=== Contractor Identification === Company Name:EXIDE CORP Address:645 PENN STREET

Box:14205 City:READING

State:PA

ZIP:19612-4205 Country:US

Phone:610-378-0500/0798

CAGE:20038

======= Composition/Information on Ingredients ========

Ingred Na

me:LEAD (SARA 313) (CERCLA)

CAS:7439-92-1

RTECS #:OF7525000 Fraction by Wt: 60%

Other REC Limits: NONE RECOMMENDED

OSHA PEL:SEE 1910.1025

ACGIH TLV:0.05MG/M3, A3; 9596

EPA Rpt Qty:1 LB DOT Rpt Qty:1 LB

Ingred Name: ANTIMONY (SARA 313) (CERCLA)

CAS:7440-36-0

RTECS #:CC4025000 Fraction by Wt: 2%

Other REC Limits: NONE RECOMMENDED

OSHA PEL:0.5 MG/M3

ACGIH TLV:0.5 MG (SB)/M3; 9596

EPA Rpt Qty:5000 LBS DOT Rpt Qty:5000 LBS

Ingred Name: ARSENIC (SARA 313) (CERCLA)

CAS:7440-38-2

RTECS #:CG0525000

Fractio

n by Wt: 0.2%

Other REC Limits: NONE RECOMMENDED

OSHA PEL:SEE 1910.1018

ACGIH TLV:0.01 MG/M3, A1; 9596

EPA Rpt Qty:1 LB DOT Rpt Qty:1 LB

Ingred Name: CALCIUM, METAL

CAS:7440-70-2

RTECS #:EV8040000 Fraction by Wt: 0.2%

Other REC Limits: NONE RECOMMENDED

Ingred Name:TIN CAS:7440-31-5

RTECS #:XP7320000 Fraction by Wt: 0.2%

Other REC Limits: NONE RECOMMENDED

OSHA PEL:2 MG/M3

ACGIH TLV:2 MG/M3; 9596

Ingred Name: SULFURIC ACID (SARA 302/313) (CERCLA)/ELECTROLYTE

CAS:7664-93-9

RTECS #:WS5600000

Fraction

by Wt: 10 - 30%

Other REC Limits: NONE RECOMMENDED

OSHA PEL:1 MG/M3

ACGIH TLV:1 MG/M3/3 STEL; 9596

EPA Rpt Qty:1000 LBS DOT Rpt Qty:1000 LBS

Ingred Name: CASE MATERIAL

Fraction by Wt: 5 - 10%

Other REC Limits: NONE RECOMMENDED

Ingred Name: SILICA, CRYSTALLINE - FUSED (GEL CELL BATTERIES ONLY)

CAS:60676-86-0 RTECS #:VV7328000 Fraction by Wt: 10%

Other REC Limits: NONE RECOMMENDED

OSHA PEL:SEE TABLE Z-3

ACGIH TLV:0.1 MG/M3 RDUST;9596

Ingred Name: SHEET MOLDING COMPOUND

Fraction by Wt: 10%


Other REC L

Flash Point: NON-FLAMMABLE

=========== Accidental Release Measures ================

Spill Release Procedures: WEAR PROTECTIVE EQUIPMENTS. REMOVE COMBUSTIBLES & IGNITION SOURCES (H2 MAY BE PRESENT). CONTAIN BY DIKING AND COVER SPILL WITH SODA ASH OR QUICKLIME. MIX WELL. CHECK THAT MIXTURE IS NEUTRAL. COLLECT A ND PLACE IN A DRUM. DO NOT FLUSH TO SEWER.

Neutralizing Agent

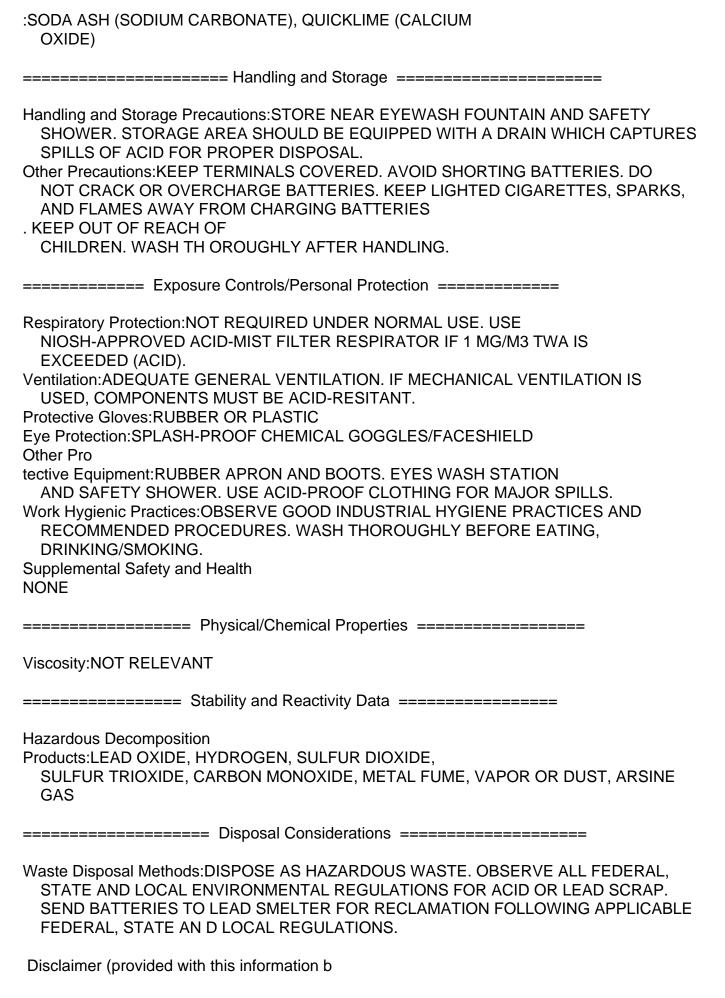

y the compiling agencies):

This information is formulated for use by elements of the Department of Defense. The United States of America in no manner whatsoever, expressly or implied, warrants this information to be accurate and disclaims all liability for its use. Any person utilizing this document should seek competent professional advice to verify and assume responsibility for the suitability of this information to their particular situation.